


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 33, Township 102, Range 40, 5th P.M.STATE OF MINNESOTA, County of NOBLES

At the corner location shown on the sketch:

- On 6-07 found a 7/8" PIPE 1/2" BELOW BIT SURFACE AT CENTERLINE OF
BIT ROAD 17.27' EAST OF TRUE CORNER (USED IN PREVIOUS SURVEYS)
 left monument as found, lowered monument, removed monument (expalin)
- On 6-22-07 placed a PLS MNDOT CAP ON A 30" UNISTRUT AT CALCULATED
POSITION (SEE BACK FOR DETAILS)

SKETCH OF REFERENCE TIES

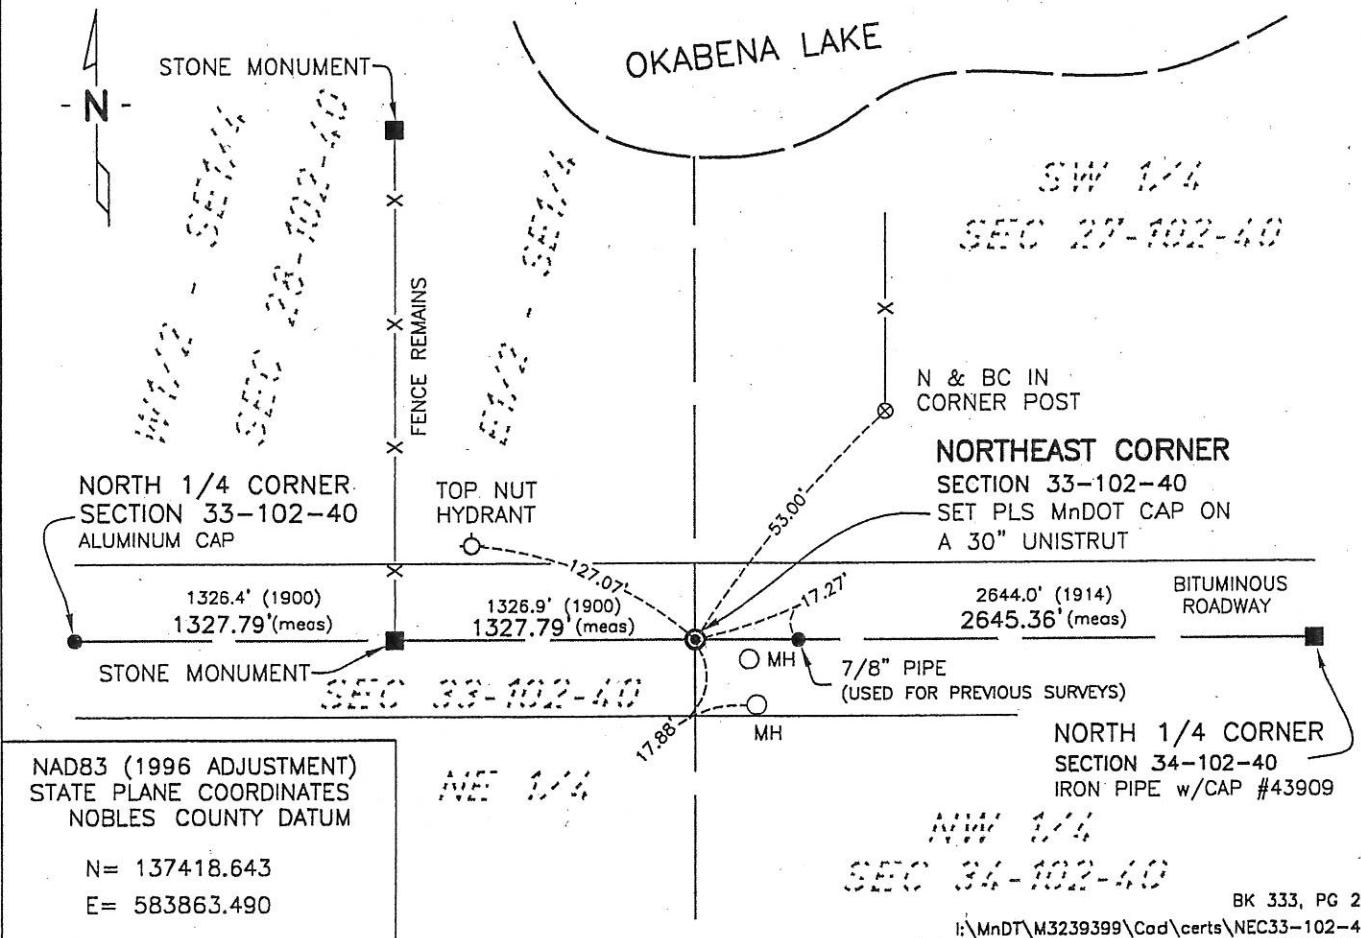

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

JOSEPH A. HAEFNER

6-25-007

DATE

OFFICE OF THE COUNTY RECORDER

County of _____
I hereby certify that this document was filed in the Co. Recorders office at _____.M. on the _____ day of _____ A.D., 20_____
County Recorder _____Registration No. 43909

- Land surveyor, Professional Engineer
 County Surveyor, County Engineer

By _____, Deputy
DOCUMENT NO. _____

1868	George G. Howe, U.S. Deputy Surveyor, his notes read: "North between sections 33 & 34, Var. 11°15'E" @ 80.00 chs "set post in mound with pits for corner to sections 27, 28, 33 & 34", no ties.	Northeast Corner Section 33, Township 102 North, Range 40 West	
1880	Nobles County Recorder's Office, Surveyor's Record, Volume B, Page 60, by Milton S. Nobles County Recorder's Office, Surveyor's Record A-2, Page 60, by Milton S.	Nobles County Recorder's Office, Surveyor's Record, Volume B, Page 57 by William A. Saxon, County Surveyor, for a survey of Section 28, shows stones at the SE corner, for a survey of Section 34, shows a distance of south 2656.5' to the corresponding quarter section corner. There is no mention of any monumentation.	
1892	Nobles County Recorder's Office, Surveyor's Record, Volume B, Page 132, for a survey of Section 34, shows a distance of south 2652.5' to the corresponding quarter section corner. There is no mention of any monumentation.	Nobles County Recorder's Office, Surveyor's Record, Volume B, Page 132, for a survey of Section 34, shows a distance of south 2652.5' to the corresponding quarter section corner. There is no mention of any monumentation.	
1895	1995	Nobles County Highway Department records show an iron pin at this corner. Madsen Land Surveying Inc., File No. 9547, for a survey in Section 28 states "found 3/8" rod (4" deep) & replaced with 3/4" O.D. x 12" DP". Note: the true location of this corner is uncertain dimensions shown on surveys dated May 1, 1900 & July 20, 1914 conflict with the monument currently in use.	
1998	City of Worthington GPS survey, found 7/8" iron pipe (2" deep)" Note: some old record distances do not fit with this corner location. However this position has been used for past many years" Zieske Land Surveying, Inc., Project No. N 0306 S, for a survey in Park View Acres shows the corner. There is no mention of what type of monumentation exists.	Zieske Land Surveying, Inc., Project No. N 0306 S, for a survey in Park View Acres shows the corner. There is no mention of what type of monumentation exists.	
2003	20 June 2003	City of Worthington GPS survey, found 7/8" iron pipe (2" deep)" Note: some old record distances do not fit with this corner location. However this position has been used for past many years" Zieske Land Surveying, Inc., Project No. N 0306 S, for a survey in Park View Acres shows the corner. There is no mention of what type of monumentation exists.	20 June 2003
2006	20 July 2006	Minnesota Department of Transportation, survey crew found 7/8" pipe 1/2" below bituminous surface at centerline of road.	20 July 2006
2007	9 May 2007	Balton & Menk, Inc., survey crew found the above referenced 7/8" pipe, distances of west 2672.78' and east 2628.15' were measured to the pipe, distances of west 2672.78' and east 2628.15' were measured to the pipe.	9 May 2007

- 18 June 2007 -Bolton & Menk, Inc., survey crew cut a hole in the bituminous roadway and searched with a 6' probe in all directions and found no evidence of the above referenced stone. Bolton & Menk, Inc., survey crew did however locate a stone monument at the S1/6 of the SE1/4 in the centerline of bituminous roadway 4' deep, a distance of west 1327.79' was measured to the corresponding ¼ section corner.
- 21 June 2007 -Bolton & Menk, Inc., calculated the position of the corner by doubling over the distance from the South Quarter Corner and the found stone at the S1/6 of the SE1/4 and set a PLS MnDot Cap on a 30" Unistrut. Distances of west 2655.58' east 2645.49' and south 2651.19' were measured from the calculated position to the corresponding ¼ section corners.

The written evidence shows a large gap of unrecorded and unavailable information about this corner location between 1922 and 1967. After which there seems to be uncertainty as to the true corner location. There is nothing that ties the iron monuments used for numerous surveys from 1967 – present with the previously documented stone, furthermore, the distance measurements between said iron monument and the 1900 & 1914 surveys are not in agreement.

The occupational and collateral evidence, most particularly along the centerline of the SE1/4, suggest the location of the above referenced calculated position is the most reasonable location as to the true corner location. The fact that the distance measurements from the 1900 & 1914 are in agreement with the 2007 measurements further supports this decision. Additional information regarding the preparation of this certificate can be obtained by contacting: Bolton & Menk, Inc., 219 North Main Street, Fairmont, MN 56013.

